

Case study 1


The Sri Lankan Pumpkin Tank

Background Information

The Sri Lankan Pumpkin Tank, and the associated construction technique, was developed as part of a World Bank sponsored Water and Sanitation Programme which was implemented in the country between 1995 and 1998. The Community Water Supply and Sanitation Programme (CWSSP) covered 3 districts within the country Badulla, Ratnapura and Matara Districts. Hundreds of these tanks were built in areas where conventional supply schemes, such as piped supplies or groundwater supplies, were difficult to provide. In some areas members of the target community were given the choice of a RWH system for individual households or a groundwater supply

for a group of households. The choice varied. In all cases there was a choice of type of tank either the Pumpkin tank or an underground tank which is described in Case Study 2. The choice was usually a function of ground conditions rather than personal preference. Both tanks have a capacity of approximately 5m³.

The Abikon family of Demetaralhina in Badulla District chose a pumpkin tank. Their village is in a rural highlands area of the country and the ground conditions were not suitable for a groundwater supply or for digging a pit for a below ground tank. Average annual rainfall is 2250mm with a bimodal rainfall pattern and a dry period, usually between December and April. Their per capita consumption was well below the 20 litres per day that each family member now consumes. The water is used for drinking (but only after boiling), cooking, personal and clothes washing. Mr Abikon also uses the water from their tank to water their 4 cows. Only towards the end of the dry season does the tank sometimes dry and then the family has to walk to the spring, about a mile from their home.

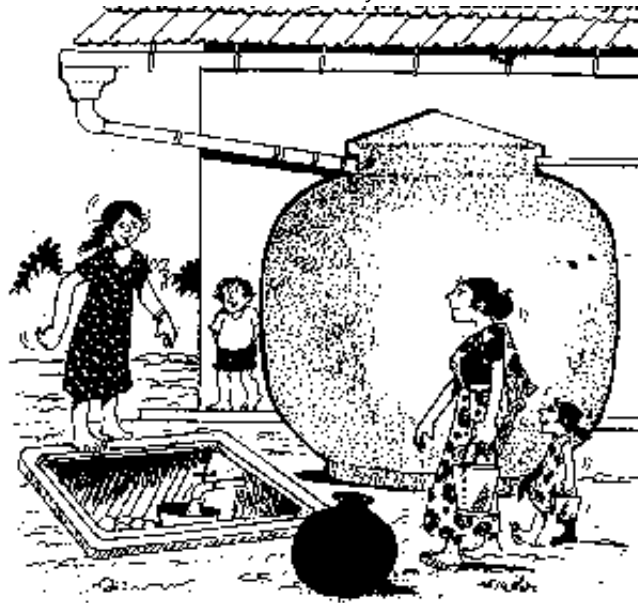

Technical details

Rainwater is collected from only 1 side of the pitched roof, a collection area of 32m^2 . The roofing material is a mix of zinc and asbestos sheeting. The guttering is a PVC U-channel, factory manufactured, found commonly in the nearby town, fitted to a fascia board with similarly manufactured brackets, spaced at 300mm centres. The downpipe is a standard 3" PVC pipe, although

some of the neighbours use less costly downpipes made from string and plastic tubing. The cost of the guttering is approximately SLR5,600, about Sterling 86.00.

This pumpkin tank was built 3 years ago and is in very good condition. The construction is of ferrocement. The construction detail is given later. The cost of the tank is approximately SLR5,000 or Sterling 77.00. The materials and specialist labour for the tank were provided by CWSSP and the guttering was purchased by the Abikon family.

Water extraction is through a tap piped to a point slightly away from the tank, where the ground falls away and allows a bucket to be placed easily under the tap. There is a first flush mechanism fitted in the form of a simple PVC elbow with a length of pipe which diverts the dirty first water away from the

inlet chamber. The inlet chamber also acts as the prefilter chamber. The chamber is approximately 600mm cubed and contains subsequent layers of stone, charcoal and sand, through which rainwater passes.

Construction details:

The following construction details are given in the instructions which are handed out to masons during their training session:

Pumpkin (Wataka) Tank Construction details

1. Prepare skeleton / framework legs (see Figure 1) as shown in the drawing. 10 no. required. Prepare the crown ring. This can be used again for many tanks.

Figure 1 photo one of the 10 framework legs used as the skeleton for the tank

1. Lay the concrete base using two layers of chicken wire as reinforcing. Allow 300mm of chicken wire to protrude all around the edge of the

base. This will be connected to the wall mesh later. Lay 10 anchor bolts for the legs in the base while casting (the diameter will depend on the diameter of the holes in the legs).

1. Leave the base for 7 days to cure, wetting each day.
2. Secure the 10 skeleton legs using the bolts and the crown ring.
3. Take 6mm steel rod and wrap it around the outside of the legs, starting at the bottom and working up at 10cm intervals.
4. Fix 2 layers of chicken wire over the outside of the skeleton. The filter tower can be added at this point if a filter is to be fitted.


[Figure 2 photo a Pumpkin tank under construction - image 1](#)

[Figure 3 photo a Pumpkin tank under construction - image 2](#)

5. Plaster the outside of the mesh. Leave for 1 day.
6. Go inside the tank and remove the skeleton.
7. Plaster inside the tank and cure for 7 days.

Water proofing can be added to the mortar. This can be a specialist additive or liquid dishwashing soap.

Cure the tank by wetting for 7-10 days. Fill the gradually starting on day 7, filling at a rate of approximately 300mm per day.

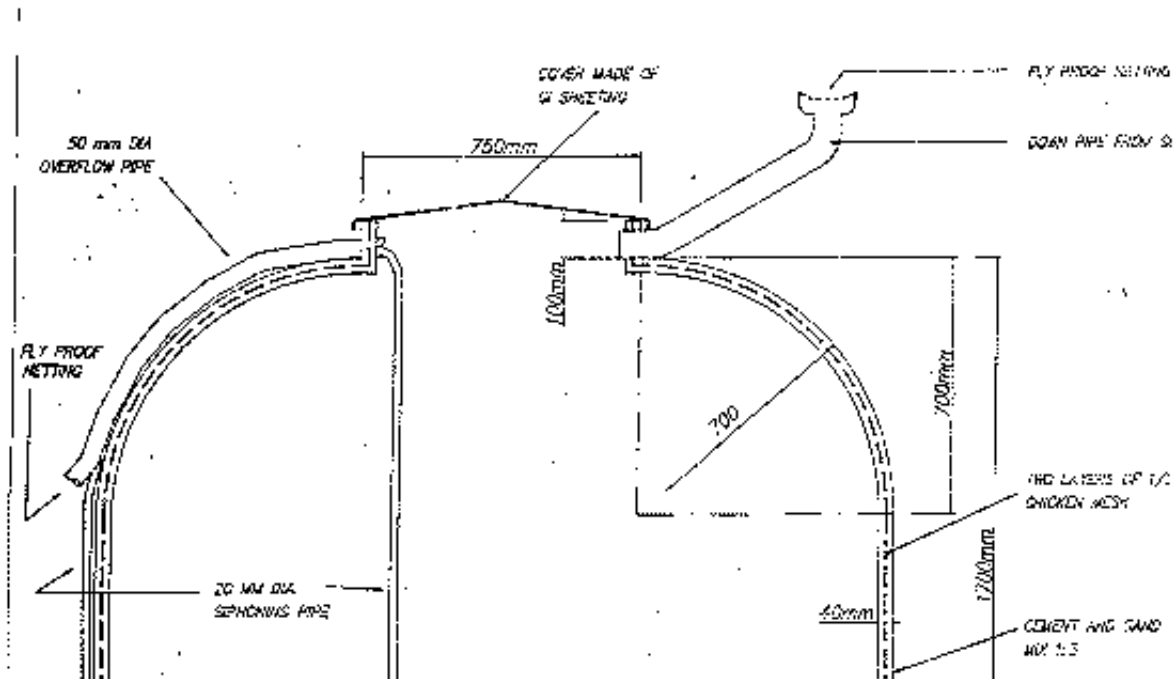

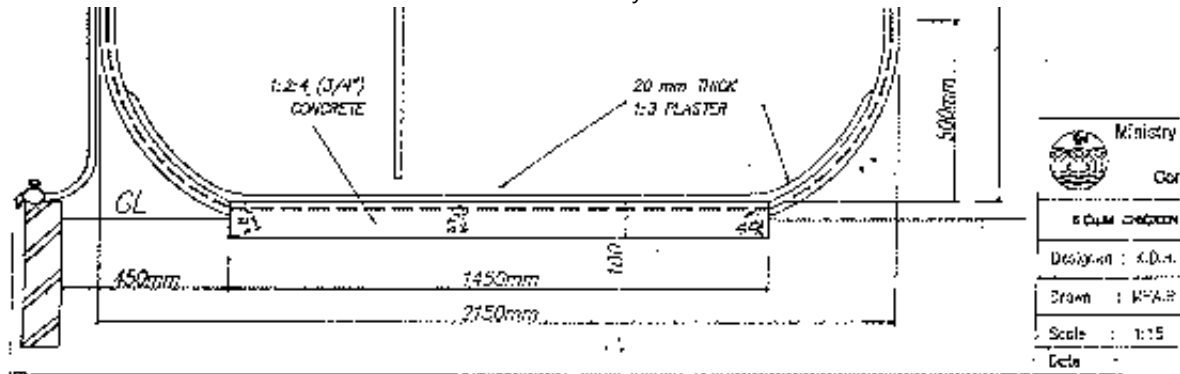


Figure 4 - technical detail of the Pumpkin tank

More Pumpkin Images

[Image 1](#)

[Image 2](#)

[Image 3](#)

Materials and labour breakdown

Material	Unit	Qty	Unit Cost	Total cost
Cement	Bag	8	265	2120
Sand	ft ³	55	3.5	192.5
Metal	ft ³	6	18	108
" Chicken Mesh	ft ²	366	4	1464
Mould		1	325*	325
Transport				500
Skilled labour	hr	56	22	1232

Unskilled labour	hr	112	12.5	1400
			Total	7341.5

*Assuming mould is used for 10 tanks

All costs given in Sri Lankan Rupees

65 SL Rupees = Sterling 1.00

[\(return to top of page\)](#)

[\(return to main case study page\)](#)

[home.cd3wd.ar.cn.de.en.es.fr.id.it.ph.po.ru.sw](#)